

WL810E Motherboard Specification Update

Release Date: May 2001

Order Number: A23576-002

The WL810E motherboard may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are documented in this Specification Update.

INFORMATION IN THIS DOCUMENT IS PROVIDED IN CONNECTION WITH INTEL® PRODUCTS. EXCEPT AS PROVIDED IN INTEL'S TERMS AND CONDITIONS OF SALE FOR SUCH PRODUCTS, INTEL ASSUMES NO LIABILITY WHATSOEVER, AND INTEL DISCLAIMS ANY EXPRESS OR IMPLIED WARRANTY, RELATING TO SALE AND/OR USE OF INTEL PRODUCTS INCLUDING LIABILITY OR WARRANTIES RELATING TO FITNESS FOR A PARTICULAR PURPOSE, MERCHANTABILITY, OR INFRINGEMENT OF ANY PATENT, COPYRIGHT OR OTHER INTELLECTUAL PROPERTY RIGHTS. INTEL PRODUCTS ARE NOT INTENDED FOR USE IN MEDICAL, LIFE SAVING, OR LIFE SUSTAINING APPLICATIONS.

Intel Corporation may have patents or pending patent applications, trademarks, copyrights, or other intellectual property rights that relate to the presented subject matter. The furnishing of documents and other materials and information does not provide any license, express or implied, by estoppel or otherwise, to any such patents, trademarks, copyrights, or other intellectual property rights.

Intel retains the right to make changes to specifications and product descriptions at any time, without notice.

The WL810E motherboard may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are available on request.

Contact your local Intel sales office or your distributor to obtain the latest specifications before placing your product order.

* Third party brands and names are the property of their respective owners.

Copies of documents which have an ordering number and are referenced in this document, or other Intel literature, may be obtained from:

Intel Corporation P.O. Box 5937 Denver, CO 80217-9808

or call in North America 1-800-548-4725, Europe 44-0-1793-431-155, France 44-0-1793-421-777, Germany 44-0-1793-421-333, other Countries 708-296-9333

Copyright @ 2001, Intel Corporation. All rights reserved.

CONTENTS

REVISION HISTO	RY	,	١
PREFACE		······································	/
Specification Upo	date for WL810E Motherboards		
GENERAL INFOR	MATION		3
ERRATA			Ę



REVISION HISTORY

Date of Revision	Version	Description
April 2000	-001	This document is the first Specification Update for the Intel® WL810E motherboard.
May 2001	-002	Added Erratum 1. Removed BIOS/Errata cross-reference table.



PREFACE

This document is an update to the specifications contained in the WL810E Motherboard Technical Product Specification (Order number A12504). It is intended for hardware system manufacturers and software developers of applications, operating systems, or tools. It will contain Specification Changes, Errata, Specification Clarifications, and Documentation Changes.

Refer to the *Pentium*[®] *III Processor Specification Update* (Order number 244453) for specification updates concerning the Pentium III processor. Items contained in the *Pentium III Processor Specification Update* that either do not apply to the WL810E motherboard or have been worked around are noted in this document. Otherwise, it should be assumed that any processor errata for a given stepping are applicable to the PBA revision(s) associated with that stepping.

Refer to the *Intel*[®] *Celeron* Processor Specification Update (Order number 243748) for specification updates concerning the Intel Celeron processor. Items contained in the *Intel Celeron Processor Specification Update* that either do not apply to the WL810E motherboard or have been worked around are noted in this document. Otherwise, it should be assumed that any processor errata for a given stepping are applicable to the PBA revision(s) associated with that stepping.

Refer to the Intel® 82810 Chipset: 82810/82810-DC100 Graphics and Memory Controller Hub (GMCH) Specification Update (Order Number 290659) for specification updates concerning the 82810 GMCH Controller. Items contained in the 82810 GMCH Specification Update that either do not apply to the WL810E motherboard or have been worked around are noted in this document. Otherwise, it should be assumed that any GMCH errata for a given stepping are applicable to the PBA revision(s) associated with that stepping.

Refer to the Intel® 82801 I/O Controller Hub (ICH) Specification Update (Order Number 290677) for specification updates concerning the 82801 I/O Controller Hub. Items contained in the Intel 82801 ICH) Specification Update that either do not apply to the WL810E motherboard or have been worked around are noted in this document. Otherwise, it should be assumed that any ICH errata for a given stepping are applicable to the Printed Board Assembly (PBA) revision(s) associated with that stepping.

Nomenclature

Specification Changes are modifications to the current published specifications. These changes will be incorporated in the next release of the specifications.

Errata are design defects or errors. Characterized errata may cause the WL810E motherboard's behavior to deviate from published specifications. Hardware and software designed to be used with any given Printed Board Assembly (PBA) and BIOS revision level must assume that all errata documented for that PBA and BIOS revision level are present on all motherboards.

Specification Clarifications describe a specification in greater detail or further highlight a specification's impact to a complex design situation. These clarifications will be incorporated in the next release of the specifications.

Documentation Changes include typos, errors, or omissions from the current published specifications. These changes will be incorporated in the next release of the specifications.

Specification Update for WL810E Motherboards



GENERAL INFORMATION

Basic WL810E Motherboard Identification Information

AA Revision	PBA Revision	BIOS Revision	Notes
A09946-203	A09947-203	WL81020A.86A.0005.P03	1-6
A09946-204	A09947-204	WL81020A.86A.0005.P03	1-6
A09946-205	A09947-205	WL81020A.86A.0005.P03	1-6
A09946-206	A09947-206	WL81020A.86A.0005.P03	1-6

NOTES:

- 1. The PBA number or AA number is found on a small label on the component side of the board.
- 2. The 82810 AGPset kit used on this PBA revision consists of two components as follows:

Device	Stepping	S-Spec Numbers
82810E GMCH	A2	SL3MD
82801AA ICH	B1	SL3MA
82802AB FWH	A1	SB48

- 3. The following errata are contained in the *Pentium* III *Processor Specification Update* (Order Number 244453) for the Pentium III processor and either do not apply to the WL810E motherboard or have been worked-around in this PBA and/or BIOS revision: 1. All other errata associated with the processor apply to this PBA revision.
- 4. The following errata are contained in the Intel[®] Celeron[™] Processor Specification Update (Order Number 243748) for the Celeron processor and either do not apply to the WL810E motherboard or have been worked-around in this PBA and/or BIOS revision: All other errata associated with the processor apply to this PBA revision.
- 5. The following items are contained in the 82810/82810-DC100 Graphics and Memory Controller Hub (GMCH) Specification Update (Order Number 290677) and either do not apply to the WL810E motherboard or have been worked around in this PBA and/or BIOS revision: All other errata associated with the GMCH apply to this PBA revision.
- 6. The following items are contained in the Intel® 82801 I/O Controller Hub Specification Update (Order Number TBD) and either do not apply to the WL810E motherboard or have been worked around in this PBA and/or BIOS revision: None. All other errata associated with the ICH apply to this PBA revision.



Summary Table of Changes

The following table indicates the Specification Changes, Errata, Specification Clarifications, or Documentation Changes which apply to the WL810E motherboard. Intel intends to fix some of the errata in a future revision of the motherboard, and to account for the other outstanding issues through documentation or specification changes as noted. This table uses the following notations:

CODES USED IN SUMMARY TABLE

Doc: Document change or update that will be implemented.

Fix: This erratum is intended to be fixed in a future revision of the motherboard or

BIOS.

Fixed: This erratum has been previously fixed.

NoFix: There are no plans to fix this erratum.

Shaded: This erratum is either new or modified from the previous version of the document.

NO.	PLANS	ERRATA	
1	Fixed	Intel® Pentium® III processor Erratum E76	



ERRATA

1. Intel® Pentium® III Processor Erratum E76

PROBLEM: For a complete description of the Pentium III processor erratum E76, see the Pentium III Specification Update, order number 244453 found at http://developer.intel.com/design/PentiumIII/specupdt/.

IMPLICATION: For a complete description of the Pentium III processor erratum E76, see the Pentium III Specification Update, order number 244453 found at http://developer.intel.com/design/PentiumIII/specupdt/.

WORKAROUND: Update the WL810E desktop board with BIOS revision WL81020A.86A.0013.P06.

STATUS: This erratum was addressed in BIOS revision WL81020A.86A.0013.P06.