



Product Information Update

Issue No. CA61-031BD00
Distributed to All Customers

August 1, 2000
Gill Huang
Research & Development Dept.

CA61

EC #

Symptom : When the system board is installed with an IBM PC133 single side 256MB DIMM, only 128MB of the memory size will be detected

Work around : Updates the BIOS and adds the MA14 signal (R266) to memory address.

Status : Next run.

Changes :

Model/Item	Is	Was
710-CA6102-**** (Ocean excluded)	764-CA6101-100 CA61 BIOS CK: 7C17, CL: 6, 7/27/89	764-CA6101-100 CA61 BIOS CK: BA2F, CL: 5, 6/28/89
710-CA6102-069 (For Ocean)	764-CA6101-169 CA61 Ocean BIOS CK: 66A1, CL: 9, 7/27/89	764-CA6101-169 CA61 Ocean BIOS CK: BF6A, CL: 8, 6/28/89
710-CB6102-****	263-180005-300 Res 0Ω 0603 Location: R266	None
710-CB6102-****	Removed	263-180005-300 Res 0Ω 0603 Location: R265

Manual/Addendum : Not changed.

BOM

Model/Item Part No.	Is		Was		
	PCB	BOM	Model/Item Part No.	PCB	BOM
CA61 710-CA6102-****	B1	BD00	CA61 710-CA6102-****	B1	BC00

Reviewed by

Approved by

RD

CS
